
Meeting Owl 4+

STEP 1

Place the Meeting Owl, the USB-C power cable, the USB-C cable connecting to the computer, and the Owl Stand on the table where the Owl will be used.


Take both USB-C cables and run them through the hole in the Owl Stand, entering from the bottom of the stand and exiting from the top. Connect the USB-C power cable and USB-C computer cable to the Owl. Be sure to double-check that they are fully inserted and engaged.

WARNING! Take care not to bang or scratch the lens on the Owl while attaching the Stand.

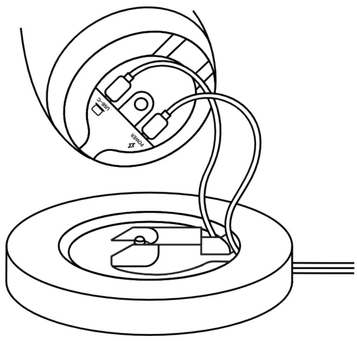


STEP 2

Gently support the Owl and match the screw built into the Stand with the threaded insert found in the bottom of the Owl. Slowly hand-turn the screw so it threads properly and check that the Owl is properly aligned.

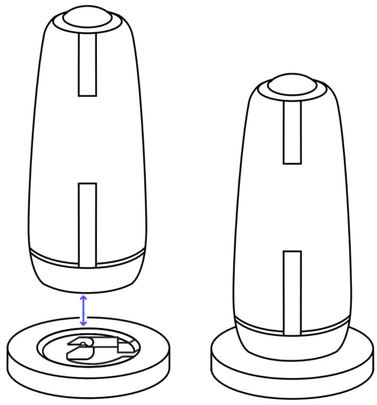

STEP 3

Once correctly aligned and hand-tightened, take the included key and tighten the screw fully. The Owl and base should be as one.

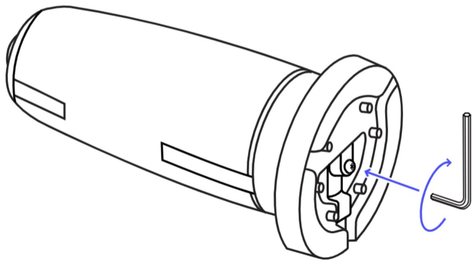

STEP 4

Route both cables up the chute being sure to push them underneath the tabs where the cables exit the Stand.

